

Cedar Grove Cemetery

Parking

There is room for about 20 parking spaces around the office but no spaces are marked and there are no designated accessible spaces.

ADAAG: Where parking spaces are provided, accessible parking spaces shall be provided in accordance with 208(208.1)

Exterior Path of Travel

There is a ¼” to ½” unbeveled change in level from the asphalt parking to the concrete walk that leads to the entrance.

ADAAG: Changes in level between ¼” minimum and ½” maximum shall be beveled with a slope not steeper than 1:2 (303.3).

Entrance

There is a symbol of accessibility sign identifying one of the two entrances as accessible. The identified entrance has about a 2” beveled threshold on the outside and a 1” unbeveled threshold on the inside. The door has a doorknob for an operating device.

ADAAG: Thresholds if provided at doorways shall be a ½” maximum in height (404.2.5). Exception: Existing or altered thresholds ¾” high maximum that have a beveled edge on each side are allowed. Operable parts shall be operable with one hand and shall not require tight grasping, pinching, or twisting of the wrist (309.4).

Restrooms

There are two single-user restrooms and neither are designed, or equipped, for accessibility. The larger of the two has a 22” door opening with 7” of maneuvering space to the latch, pull side.

ADAAG: Where toilet rooms are provided in new construction, each common use toilet room shall be accessible and comply with 603(213.2). Door openings shall provide a clear width of 32” minimum (404.2.3). A forward approach requires 18” minimum of maneuvering space to the latch, pull side of doors (404.2.4).